RAMBO-LED-FL

EVG | EVG DIMM | IP 42 | IP 66 | IP 67 | 70 000 L80B10 | IK 10 | LED

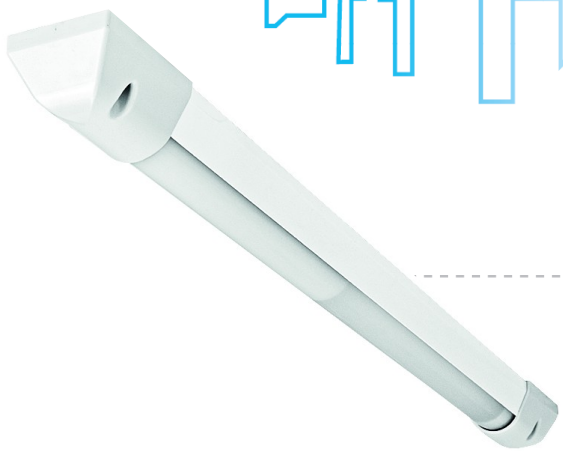

RAMBO LED

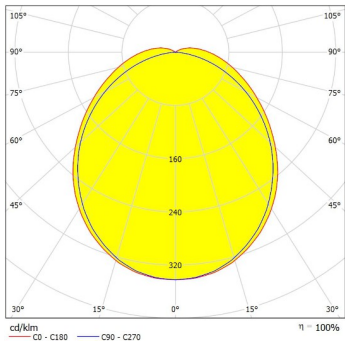

RAMBO LED

Oprawa wandaloodporna

Korpus:
Zamknięta w stalowej obudowie przezroczysta tuba z poliwęglanu o grubości ścianki 4mm i średnicy 70mm
Wyposażenie elektryczne:
moduły LED 220-240V/50-60Hz AC
DIMM – regulowany moduł DALI (opcja)
Zastosowanie:
oświetlenie pomieszczeń i przestrzeni gdzie występuje możliwość wandalizmu (np. przejścia podziemne, garaże, zakłady karne itp.).
Informacje dodatkowe:
oprawy przeznaczone są do pracy w warunkach ta 30°C.
Akcesoria dodatkowe:
004569 – specjalna śruba zabezpieczająca
002020 – klucz do śrub specjalnych
uchwyt kątowy 30°

Vandalproof luminaire

Body:
transparent polycarbonate tube with outside diameter 70mm and 4mm thick in metal sheet body.
Wiring:
LED modules
DIMM - dimmable electronic ballast (DSI, DALI – on request).
Application:
premises with high risk of damage – prisons, psychiatric hospitals, pedestrian subways etc.
Note:
suitable for work in conditions ta 30°C
Special equipment:
004569 – screw with special head
002020 – spanner for mounting and dismantling special screw
corner bracket 30°

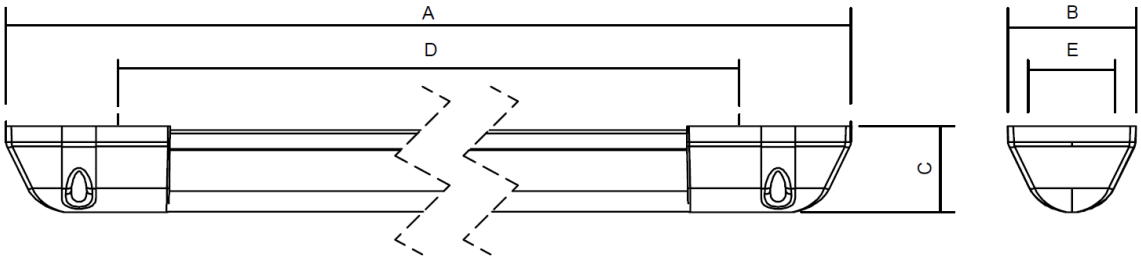

	lm (z oprawy/of fitting)	W	A	B	C	D	E	kg
RAMBO-LED-FL-2500-4K-#	1929	17	955	112	76	779	60	5,3
RAMBO-LED-FL-5000-4K-#	3858	33	1445	112	76	1276	60	7,5
RAMBO-LED-FL-7500-4K-#	5787	50	1910	112	76	1742	60	8,8

- IP42 lub IP66/67 / IP42 or IP66/67

W związku ze stałym rozwojem technologii LED, parametry mogą ulec zmianie. Strumień świetlny i obciążenie elektryczne mogą się wahać +/- 10% od wartości nominalnych. Temperatura barwowa może się wahać +/- 150K od wartości nominalnej. Uszkodzenie 1 punktu LED nie ma wpływu na skuteczność świetlną oprawy i nie jest podstawą do reklamacji takiej oprawy. | Due to program of products development a data can be changed without notice. Luminous flux and connected electrical load are subject to an initial tolerance of up to + / - 10%. Color temperature is subject to a tolerance of up to +/-150 K from the nominal value. The failure of 1 LED points causes no functional impairment to the lighting performance of the luminaire and is therefore no reason for complaint.